

## **SB, New Blade support, LB553S, LB553Se, LC48, LC348V, -VE, -VI, LC53, LC353V, -VE, -VI, LB48, LB348V, -VE, LB448S, LB548Se, 2016-01**

### **Affected models**

<b>Model</b>	<b>PNC</b>
LB 553S	967 25 71-01
LB 553Se	967 25 70-01
LC 48	All
LC 348V, VE, VI	All
LC 53	All (not for BE with BBC)
LC 353V, VE, VI	All (not for BE with BBC)
LB 48	All
LB 348V, VE	All
LB 448S	All
LB 548Se	All

### **Affected serial number(s)**

All with above PNC.

### **Description**

A new blade support will be introduced in production and as spare part. The old version could wear out the belt / pulley and cause the belt to slip.

There has also been a slipping blade issue with the LB 553 platform which will be solved with a blade support kit.

### **Action**

The new blade support is made of a different material (steel pulley) which will solve the wear issue.

The new LB553 blade support has an integrated pulley with a modified blade attachment which solves the slipping blade issue.

When the new blade support is attached to the product it's also necessary to change the mulch kits. See more under "Additional information".

The new blade support kit includes the following parts:

- ✓ Mower blade
- ✓ Blade support
- ✓ Washer (fibre)
- ✓ Spring washer
- ✓ Screw
- ✓ Instruction

The new mulch kit includes the following part:

- ✓ Mulch blade
- ✓ Mulch plug (only for Alpha)


### **Parts information**

<b>New part no.</b>	<b>Part description</b>	<b>Old part no.</b>
501 88 32-01	Blade support kit	N/A
501 88 29-01	Blade support kit	N/A
501 88 30-01	Blade support kit	N/A
501 88 31-01	Blade support kit	N/A
588 82 40-01	Blade support	N/A
582 04 44-01	Mulch kit 48 cm	585 66 05-01
582 04 45-01	Mulch kit 53 cm	585 66 06-01

### **Warranty reporting**


<b>Warranty type:</b>	Normal warranty applies (replace when broken)
<b>Residual stock:</b>	N/A
<b>Component code:</b>	601 Boss / Adaptor
<b>Defect code:</b>	08 Cracked / Split / Broken / Fractured
<b>Warranty report text:</b>	SB B160001a
<b>Time units (6 minutes):</b>	3 units
<b>Affected markets:</b>	All

**Additional information**

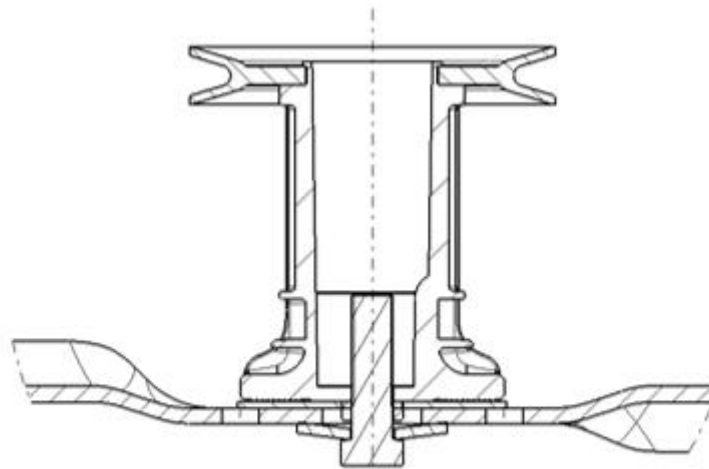


**70=Nm**

Blade Support Kit (D=83mm)	Kit P/N	Model	PNC
	501 88 32-01	Husqvarna LB553S Husqvarna LB553S e	967257101 967257001

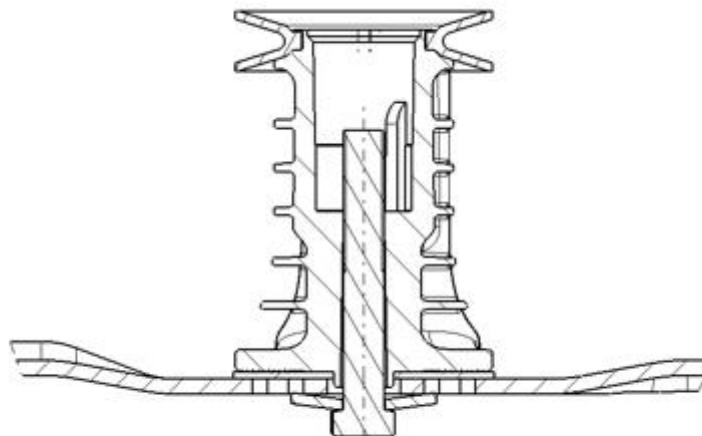

**70=Nm**

Blade Support Kit (D=60mm)	Kit P/N	Model	PNC
	501 88 29-01	Husqvarna LC48/LC348V, VE, VI	All
	501 88 30-01	Husqvarna LB48/LB348V, VE	All
	501 88 31-01	Husqvarna LC53/LC353V, VE, VI, EE	All (not for BE with BBC)

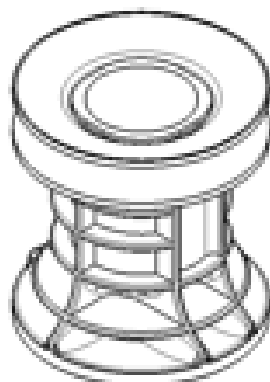

Blade Support	P/N	Model	PNC
	588 82 40-01	Husqvarna LB 448S, LB 548Se	All

**48 cm models mulch kit:**

585 66 05-01 replaced by 582 04 44-01 for model year 2016 or with the new blade support.

**53 cm models mulch kit:**

585 66 06-01 replaced by 582 04 45-01 for model year 2016 or with the new blade support.